

DRYLOK® WetLook High Gloss Sealer

MANUFACTURER

UNITED GILSONITE LABORATORIES


MAILING: P.O. Box 70, Scranton, Pennsylvania, 18501

SHIPPING: 1396 Jefferson Avenue, Dunmore, Pennsylvania, 18509

TOLL FREE: 1-800-UGL-LABS (845-5227)

PHONE: 1-570-344-1202 • **FAX:** 1-570-969-7634

www.ugl.com

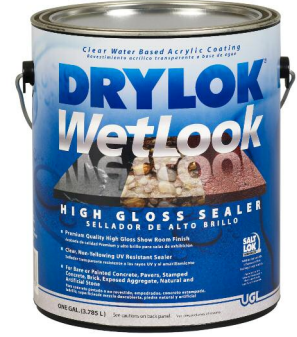

PRODUCT DESCRIPTION

DRYLOK® Wetlook Sealer provides clear weather proof protection against deterioration caused by de-icing salt, gasoline, oil, weathering and water. DRYLOK® Wetlook Sealer seals and builds to a high gloss finish on bare and previously painted masonry surfaces. Can restore beauty and cleanability to a non-glossy latex floor coating.

- Premium high gloss finish
- Resists de-icing salts
- Use on bare masonry or over previously painted surfaces

BASIC USES

Ideal for interior and exterior horizontal masonry surfaces, including concrete driveways, garage floors, basement floors, concrete sidewalks, brick walkways, terrazzo and slate surfaces.

LIMITATIONS

DRYLOK WetLook Sealer is not for use over silicone treated surfaces, or on any masonry surface subjected to hydrostatic pressure. Vertical masonry surfaces subjected to hydrostatic pressure should be treated with DRYLOK® Masonry Waterproofer.

TECHNICAL DATA

COMPOSITION:

Latex base

SHEEN:

High gloss

% WEIGHT SOLIDS:

20% ± 0.5%

% VOLUME SOLIDS:

18% ± 0.5%

DENSITY (LBS./US GAL.):

8.5 ± 0.3

VISCOSITY:

12-18 Seconds #4 Ford Cup

pH:

8.5-9.5

COLORS:

N/A

DRY TIME:

- To touch: 1 hour
- To recoat: 4 hours
- Rain free: 24 hours

Note: Maximum cure and dry time will be prolonged when slightly humid and damp, cool conditions prevail.

CLEAN UP:

Soap and water

Dispose of contaminated absorbent, container and unused contents in accordance with local, state and federal regulations.

COVERAGE (SQ. FT./US GAL.):

- 400 sq. ft./gal.

Note: Actual coverage will vary depending upon application method, surface texture and porosity.

RECOMMENDED FILM THICKNESS/COAT:

- 4 wet mils/coat

FLASH POINT:

N/A

SHELF LIFE:

5 Years

FREEZE/THAW:

Keep from freezing.

CONTAINER SIZES:

One gallon (US) and five gallon (US) containers

VOC

Does not exceed 100 g/L

TINTING

N/A

SURFACE PREPARATION

Remove all dirt, wax, dust, mildew, and loose or scaling material with a scraper, wire brush or stiff bristle brush. Grease, wax and oil should be removed by scrubbing with DRYLOK CONCRETE CLEANER & DEGREASER according to manufacturer's directions or use a heavy duty detergent in warm water. Rinse thoroughly with clean water. Allow to dry. If using a pressure washer, do not use on a pressure setting above 1750 psi to avoid damaging the concrete. Remember, concrete acts like a stone sponge. Pressure washing and general cleaning may trap residual moisture in the concrete.

To check for trapped moisture, tape a 12" x12" piece of 3 mil plastic or aluminum foil tightly on all four edges to the surface. Remove it after 24 hours. If the floor side of the plastic or foil is damp, allow additional drying and repeat the test.

EFFLORESCENCE a white, powdery crystal-like deposit visible on the masonry surface, should be removed.

DRYLOK ETCH or muriatic acid, used according to manufacturer's directions, are effective efflorescence removal agents. All masonry surfaces are subject to occurrences of efflorescence.

Properly prepared concrete should look and feel like medium grit sandpaper. If concrete remains smooth, repeat etching procedure.

Test concrete porosity by sprinkling a few drops of water onto the surface in several areas. If the water is readily absorbed, you



DRY TIME:

1 Hour
Recoat 4 Hours



CLEAN-UP:

Soap and Water



COVERAGE:

1 Coat,
2 Maximum



SPREAD RATE:

400 Sq. Ft./Gallon

are ready to paint. If it beads or lays on the surface additional cleaning and etching is needed. Rinse thoroughly with clean water and allow to dry for 24 hours.

NOTE: Rinse etching solutions thoroughly. Etching solution allowed to dry on the masonry surface will prevent proper penetration and curing of the DRYLOK® Wetlook Sealer. Surface must be thoroughly dry. Do not apply to damp surfaces. For exterior surfaces, do not apply if rain is expected within 48 hours. Wait for a dry, rain-free period.

New concrete and freshly applied portland cement based patching compounds must be cured for a minimum of 24 hours prior to application of DRYLOK® Wetlook Sealer.

Patch all holes and cracks with DRYLOK CONCRETE PATCH or a suitable cement based patching compound. Be sure to smooth the patch evenly. Allow the patched area to dry thoroughly.

WARNING

If you scrape, sand, or remove old paint, you may release lead dust. LEAD IS TOXIC. EXPOSURE TO LEAD DUST CAN CAUSE SERIOUS ILLNESS, SUCH AS BRAIN DAMAGE, ESPECIALLY IN CHILDREN. PREGNANT WOMEN SHOULD ALSO AVOID EXPOSURE. Wear a NIOSH-approved respirator to control lead exposure. Clean up carefully with a HEPA vacuum and a wet mop. Before you start, find out how to protect yourself and your family by contacting the National Lead Information Hotline at 1-800-424-LEAD or log on to www.epa.gov/lead.

APPLICATION

Stir thoroughly before application. DRYLOK® Wetlook Sealer appears milky in the can but dries clear. Apply only when air and surface temperature is above 50°F and the relative humidity is below 60%. Apply by brush, roller or spray. Spread evenly, do not allow puddles or heavy surface film to occur. Apply at least 2 coats. Multiple coats will be required on highly porous surfaces. Allow overnight drying between coats. As additional coats are applied, gloss build-up will occur and surface will become slippery when wet.

IMPORTANT: Sealed surfaces and areas adjacent to pools may become slippery when wet. Use caution when walking on surface when moisture is present.

OPTIONAL: Up to 2 oz. of DRYLOK E1 Non-Skid Texture Additive may be added to DRYLOK Wetlook Sealer to improve traction.

DRYLOK® Wetlook Sealer may be applied over existing paints and coatings. In addition to normal surface preparation old glossy surface must have the gloss removed by using sandpaper. Remove all sanding dust with a vacuum or tack cloth. Many previously coated surfaces may only require one coat.

THINNING

Thinning is not normally required but if a high gloss is not desired on sealed or non-porous surfaces like flagstone, slate, terrazzo, dense, smooth or light colored concrete, thin with clean lukewarm water. Test on a small area to see final effect.

CAUTION

KEEP OUT OF REACH OF CHILDREN. DO NOT TAKE INTERNALLY. CLOSE CONTAINER AFTER EACH USE. KEEP FROM FREEZING.

FIRST AID

EYES: Flush immediately with large amounts of water for at least 15 minutes. Consult a physician if irritation persists.

SKIN: Wash affected areas with soap and water. Consult a physician if irritation persists.

INGESTION: Seek medical attention. If individual is drowsy or unconscious, do not give anything by mouth. Place individual on the left side with head down. Contact a physician, medical facility or poison control center for advice about whether to induce vomiting.

INHALATION: Remove to fresh air.

For additional health and safety information please refer to the "Materials Safety Data Sheet".

SPECIFICATION

N/A



WetLook High Gloss Sealer
1 GAL. 2/Case28913
5 GAL. 1/Case28915

DISCLAIMER: This information is furnished without warranty, representation, inducement or license of any kind, except that it is accurate to the best of UGL's knowledge, or obtained from sources believed by UGL to be accurate, and UGL does not assume any legal responsibility for use or reliance upon same. Before using any product, read the label.